

Troubleshooting for CS Registration

(KX-UDS/UDT series)

No. 41-004

August 21 , 2012

Ver.1.0

Panasonic Corporation

Abstract about this document

This document describe about troubleshooting for CS Registration.

Revision history

Date	Version	Revision	Firmware version
Aug. 21, 2012	Ver. 1.0	Initial Release	All versions

Overview

If CSs in the same Air Sync Group don't be listed even if "CS Registration Complete" is displayed, It seems there are some troubles.

Panasonic
SIP CS KX-UDS124CE | Status | Network | **System** | VoIP | Telephone | Maintenance

Web Logout | Web Port Close

CS Management

CS Registration Complete

CS Registration

Air Sync Group: 1

CS Registration Start / Stop: Start CS Registration | Stop CS Registration

Only CS that has a check in the check box can be deleted.
CS Registration Delete: Delete CS Registration

CS Registered List


All

No.	Index	CS Name CS ID	MAC Address IP Address	CS Class	Remote Login
1	1	0018E6E900	00.80.F0.E9.76.46 192.168.1.100	Master	
<input type="checkbox"/>	2	0018E5FD00	00.80.F0.D7.55.CC 192.168.1.91	Slave	Login
<input type="checkbox"/>	3	01973040A0	00.80.F0.E9.73.76 192.168.1.96	Slave	Login
	4				
	5				
	6				
	7				
	8				
	9				
	10				

In order to find out the causes,
Please follow the flowchart in next few pages.

Trouble shooting for CS Registration


Please follow the flowchart below in order to solve a problem .

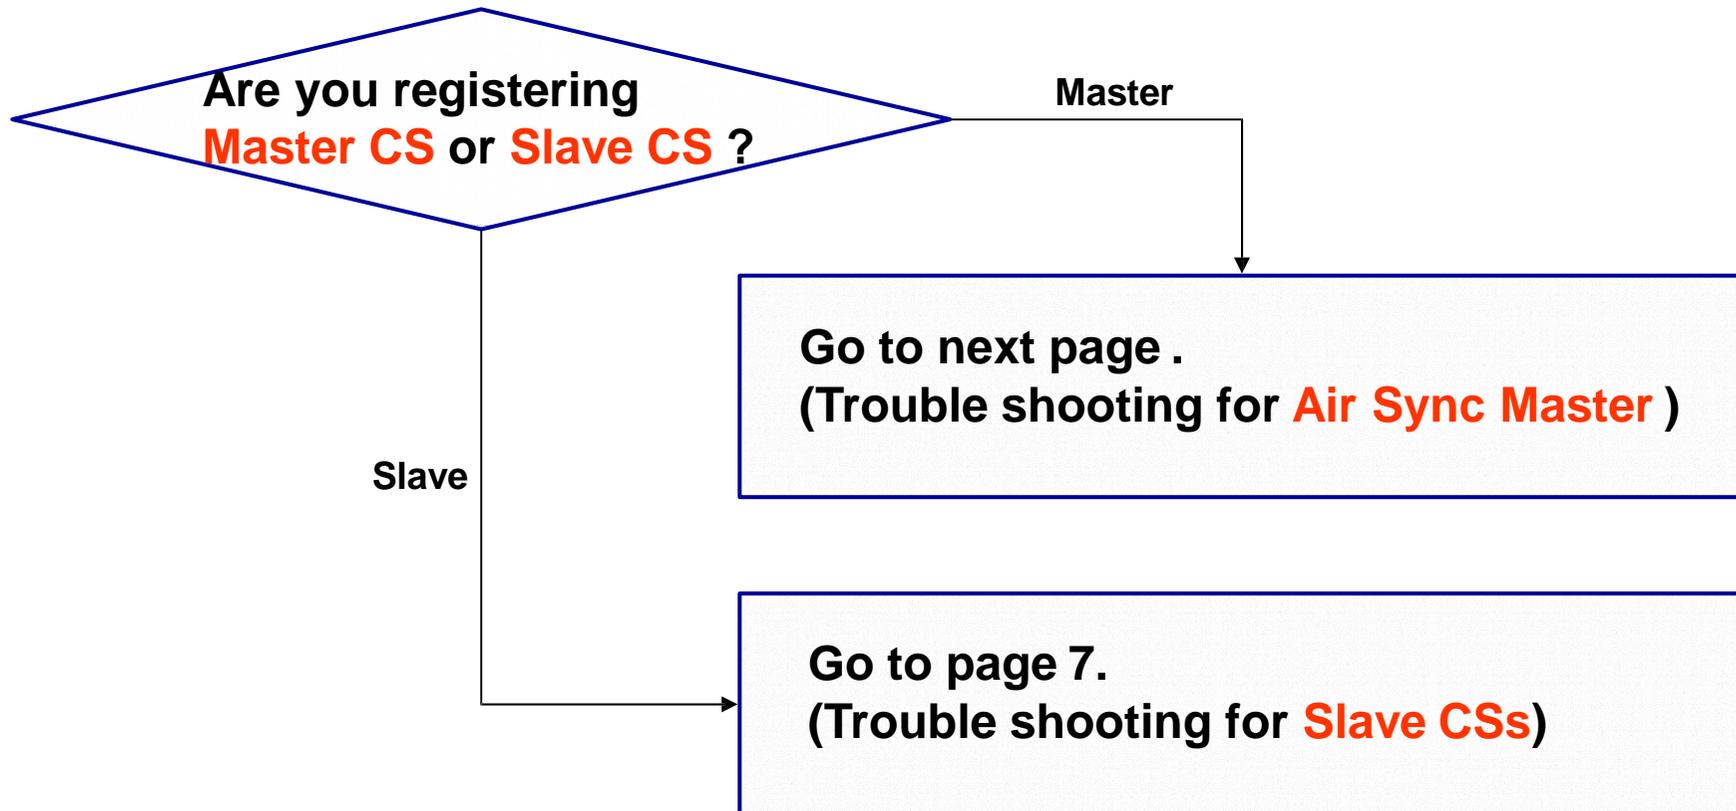


Unlike slave CS, Master CS (Group 2 to 8) doesn't need to receive a radio signal for registration.

Trouble shooting for Air Sync Master (Group 2 to 8)

In case of Air Sync Master CSs other than Super Master CS

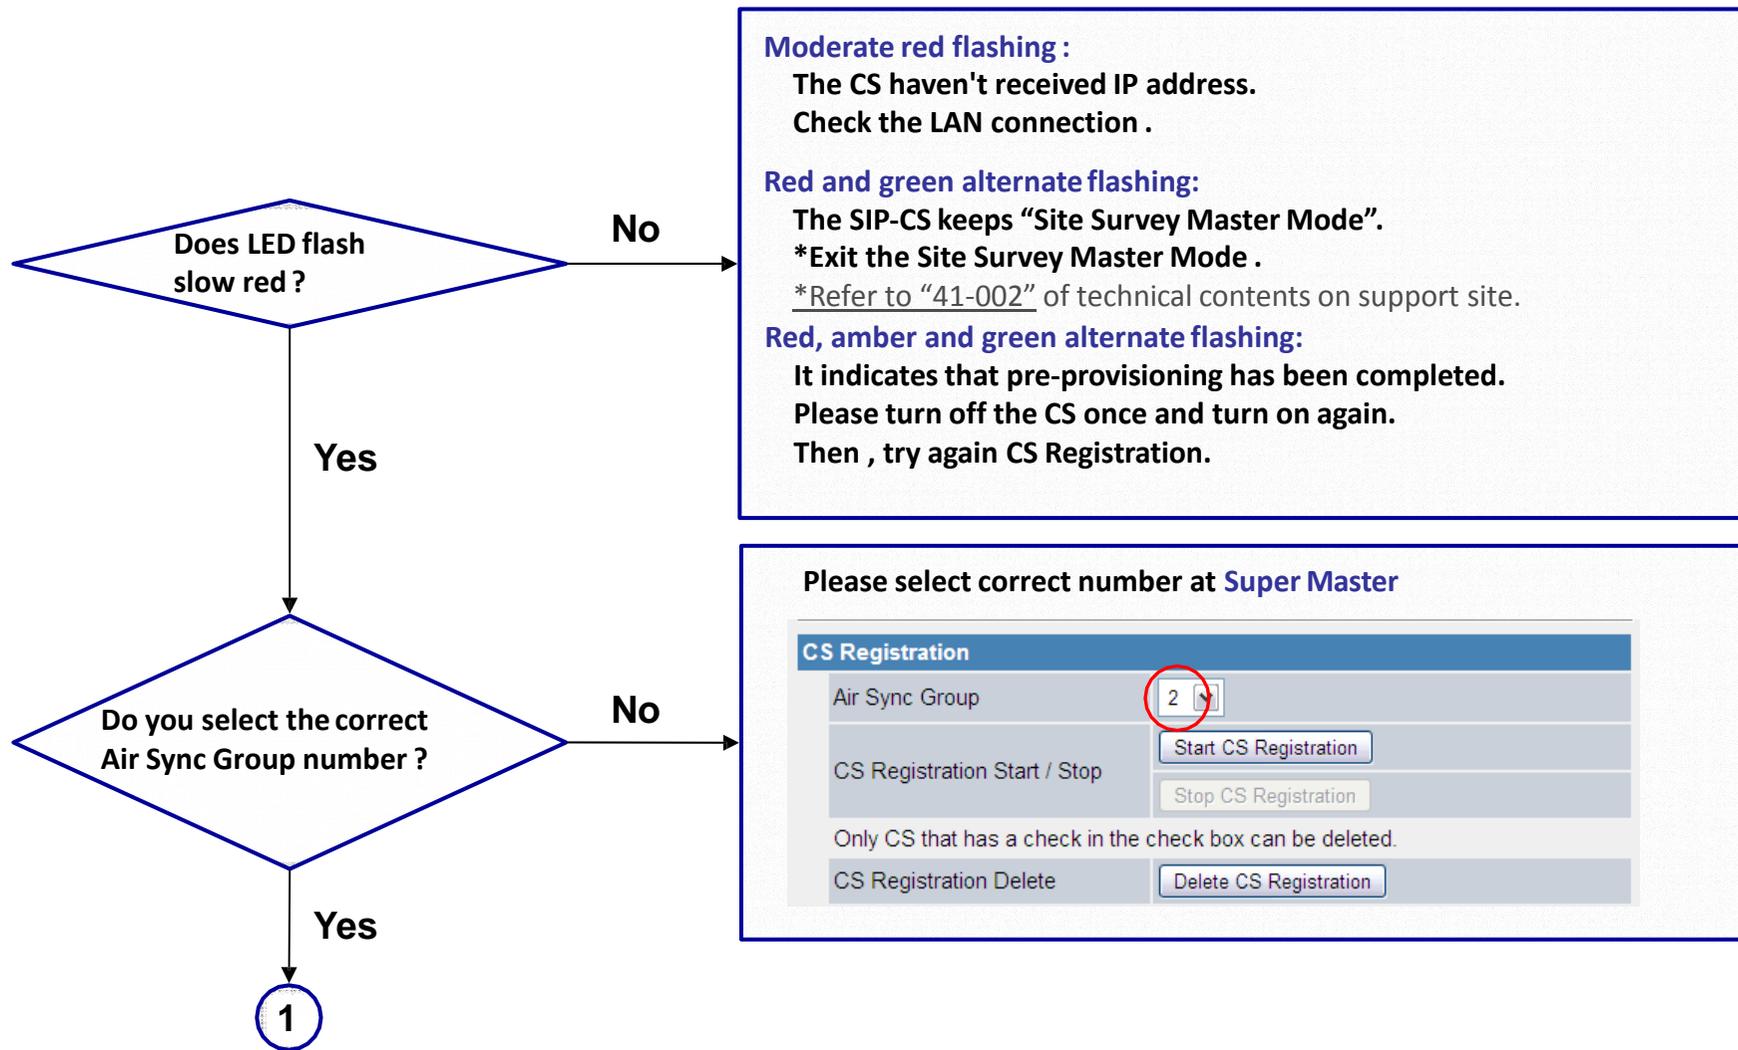


Trouble shooting for Air Sync Master (Group 2-8)

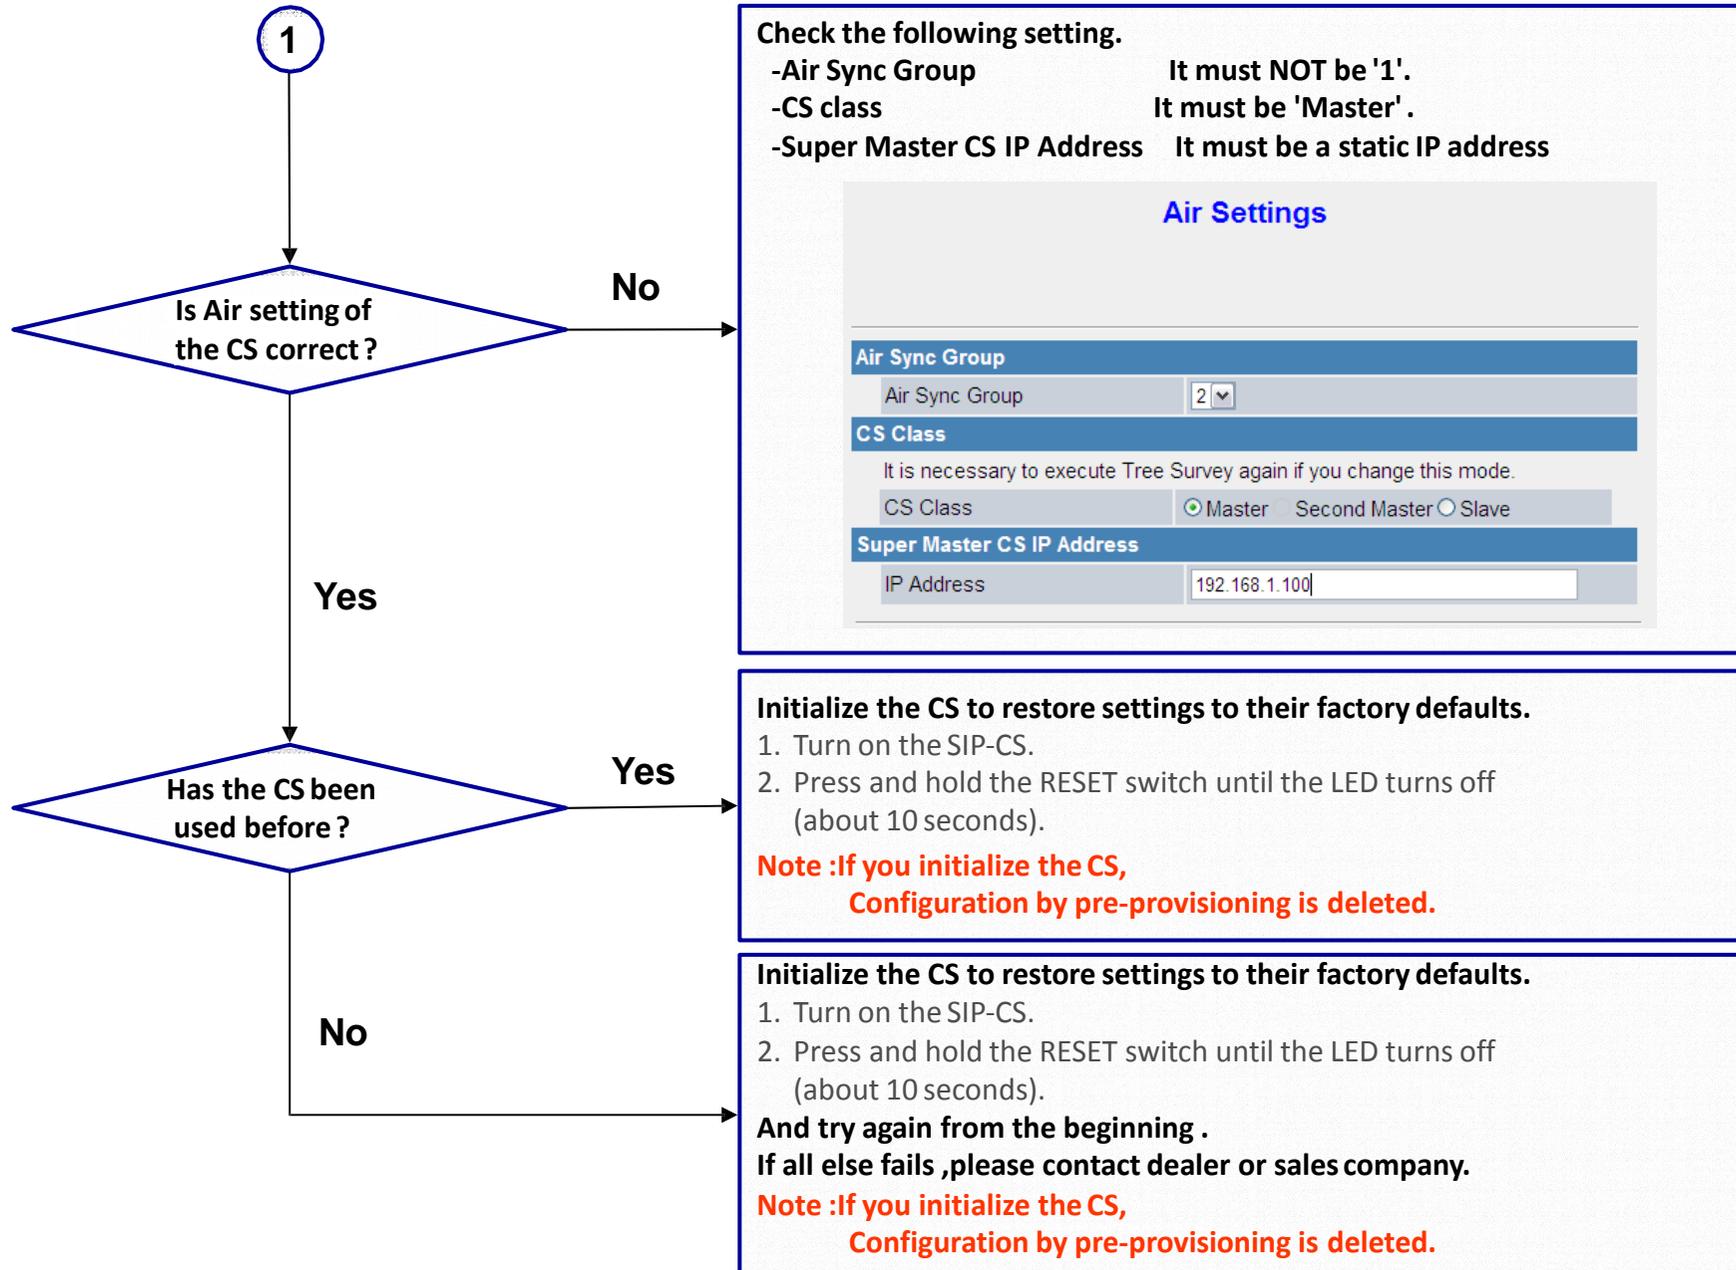


Trouble shooting for **Slave CSs**


In case of Slave CSs

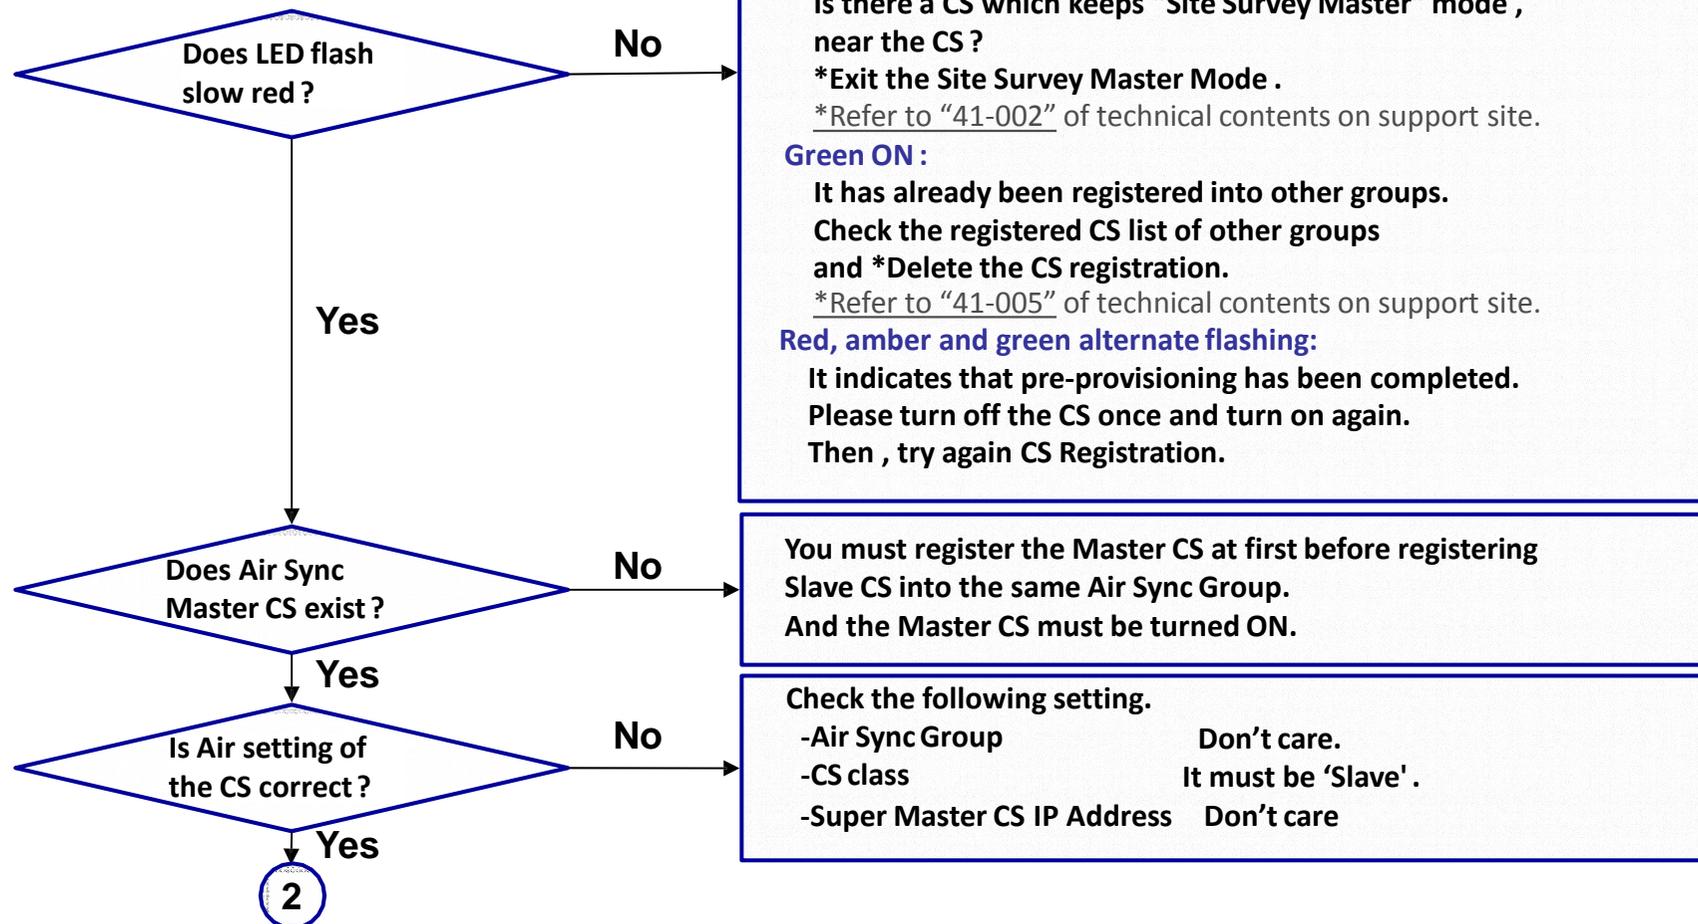

Trouble shooting for **Slave CSs**

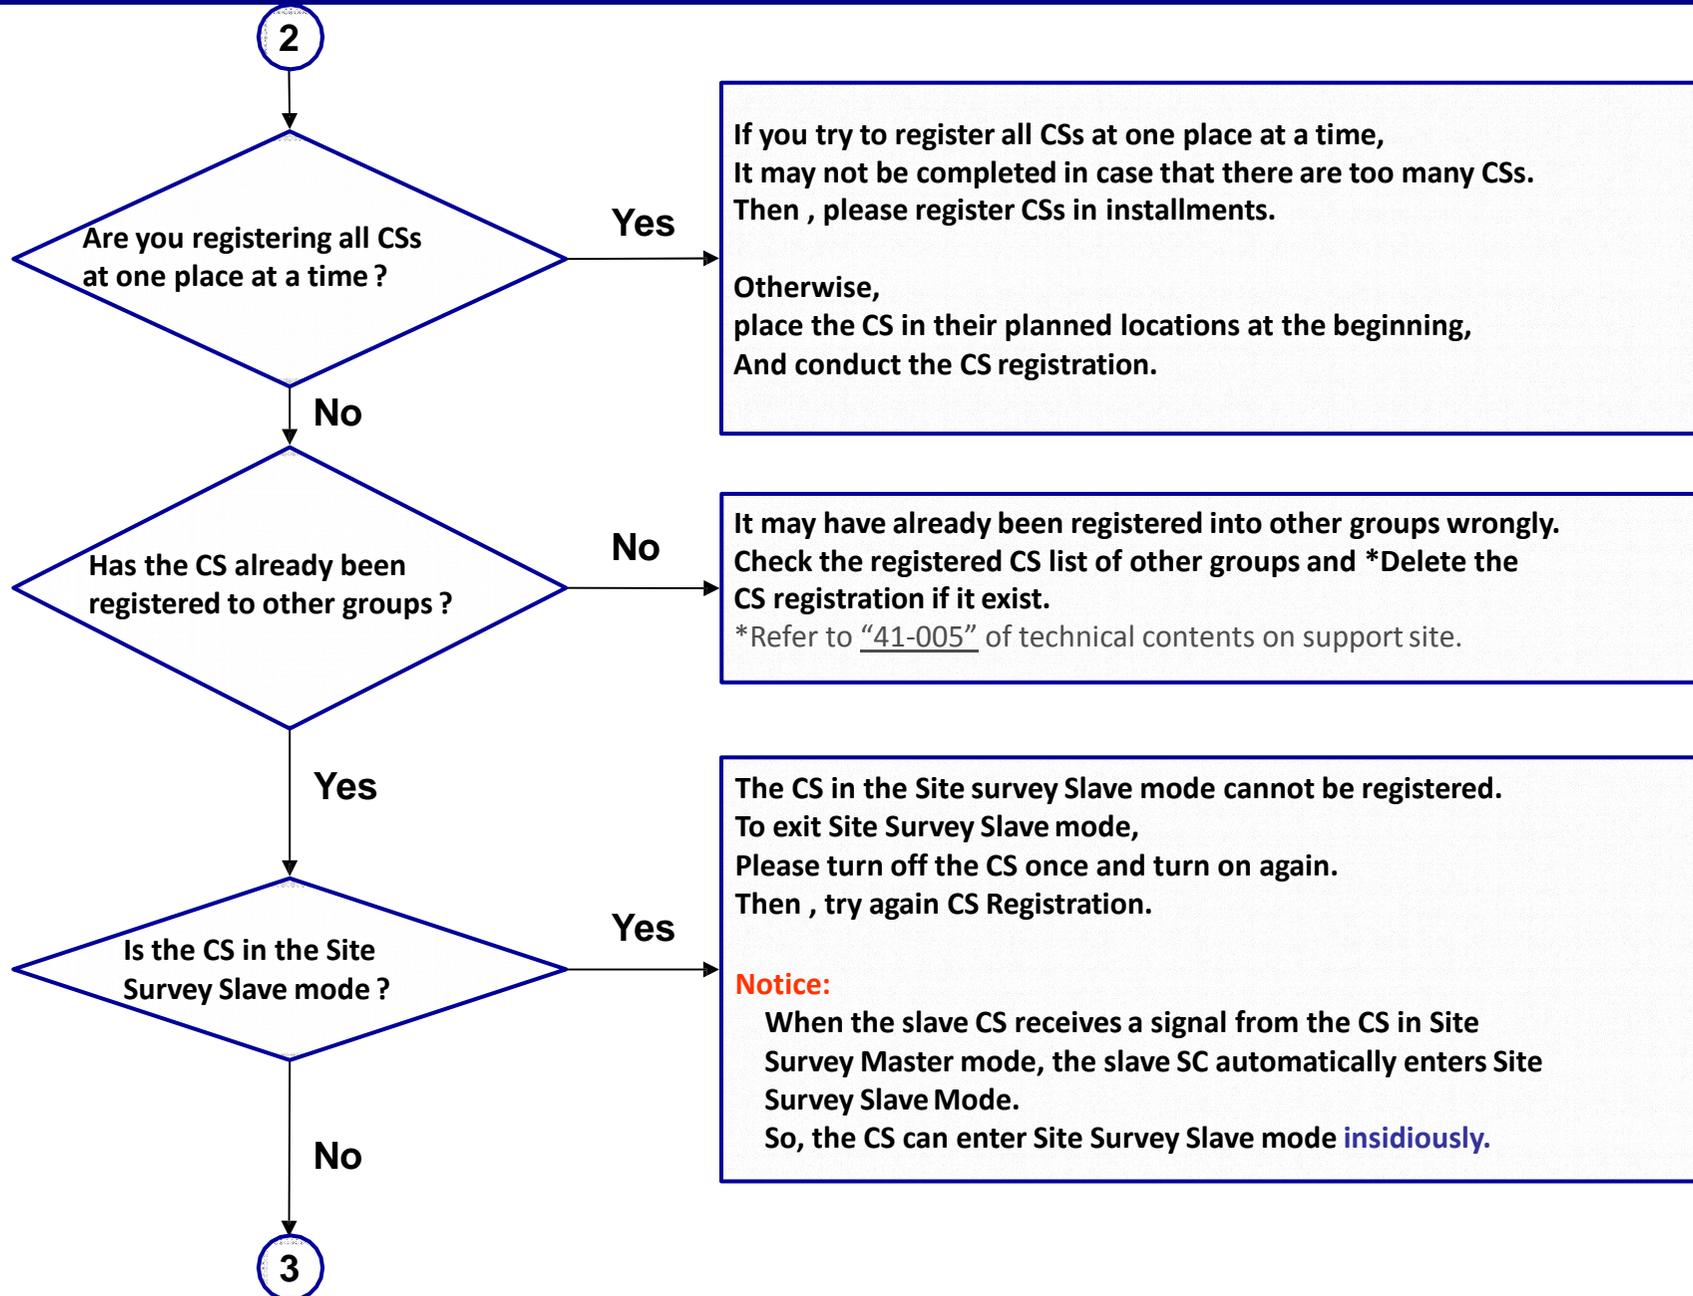

Trouble shooting for **Slave CSs**

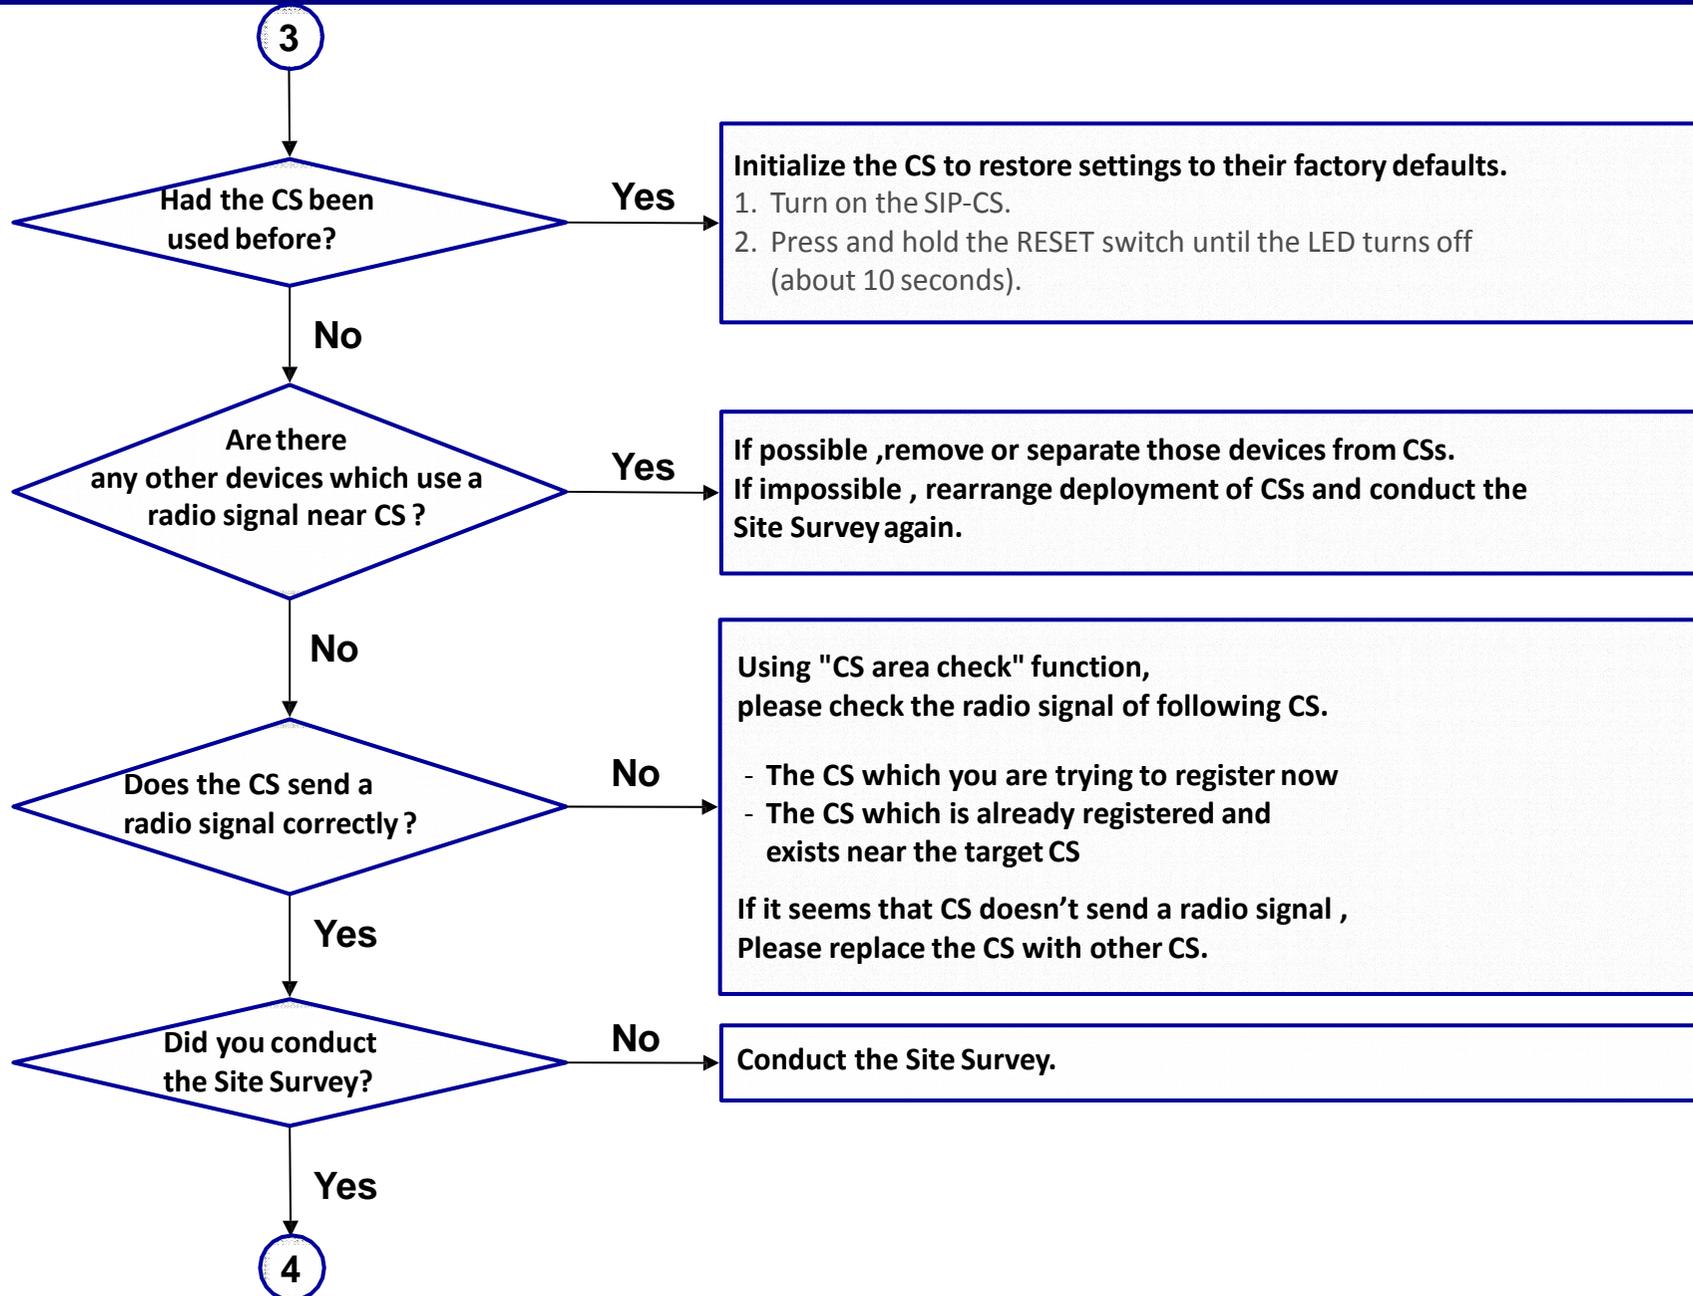

Trouble shooting for **Slave CSs**

