

How to add CS

(KX-UDS/UDT series)

No. 41-013

August 21 , 2012

Ver.1.0

Panasonic Corporation

Abstract about this document


This document describes about how to add CS.

Revision history


Date	Version	Revision	Firmware version
Aug 21, 2012	Ver. 1.0	Initial Release	All versions

Added CS Situation

Case 1 : Add CS the end of tree by manual, if you already know the configuration of the tree.

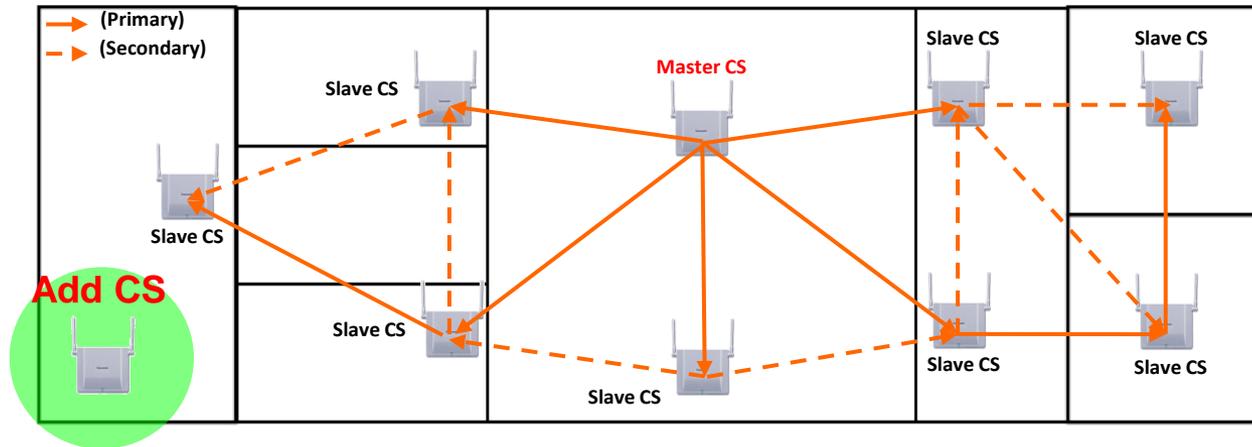


Case 2 : Add CS the inside circle of installed tree.

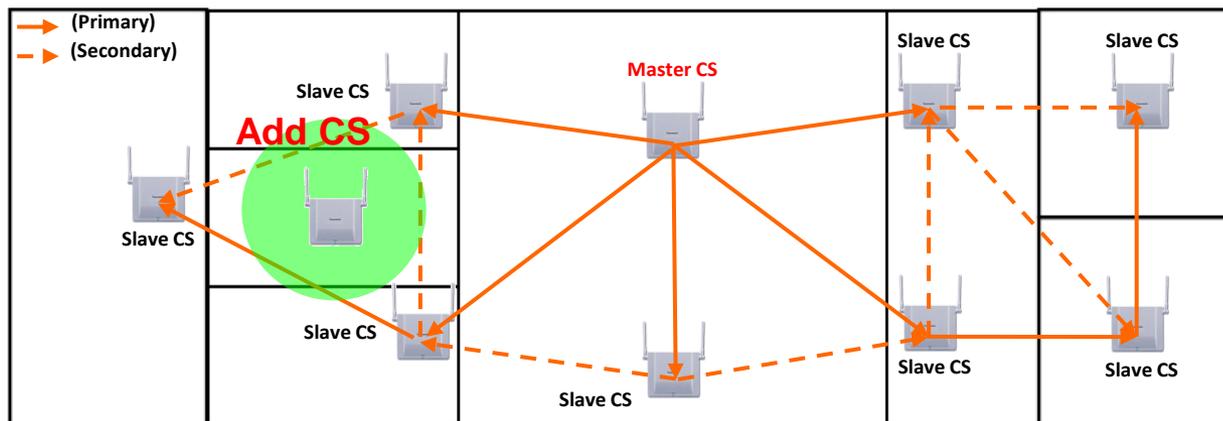

Step1 : Site Survey

Case 1 : Add CS the end of tree by manual, if you already know the configuration of the tree.

1. Set Site Survey Mode.
 3. Exit Site Survey Mode.
- Refer to "41-002".

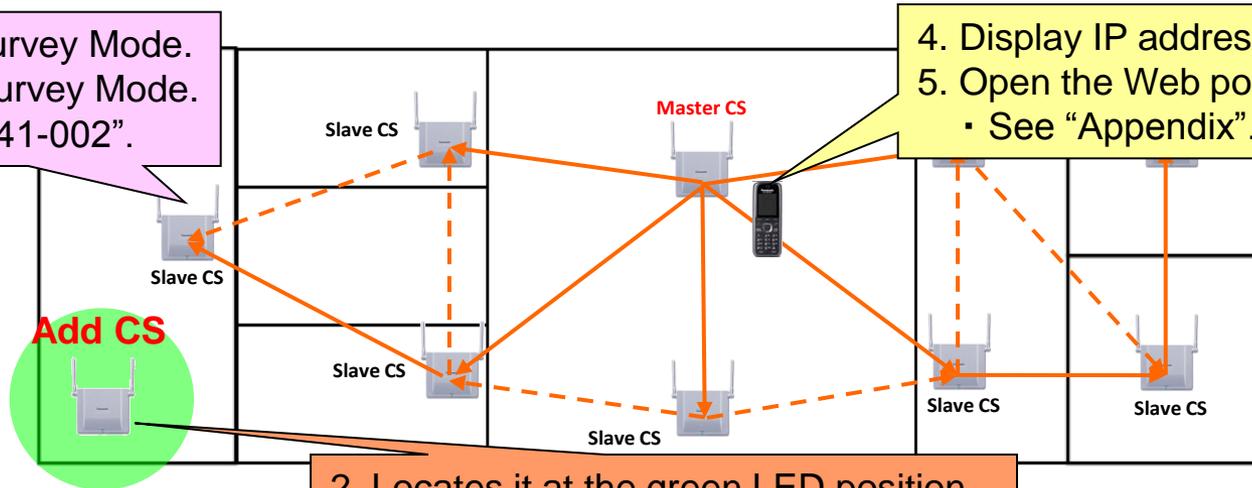


4. Display IP address of Super Master CS.
 5. Open the Web port.
- See "Appendix".

2. Locates it at the green LED position.

Case 2 : Add CS the inside circle of installed tree.

1. Set Site Survey Mode.
 3. Exit Site Survey Mode.
- Refer to "41-002".

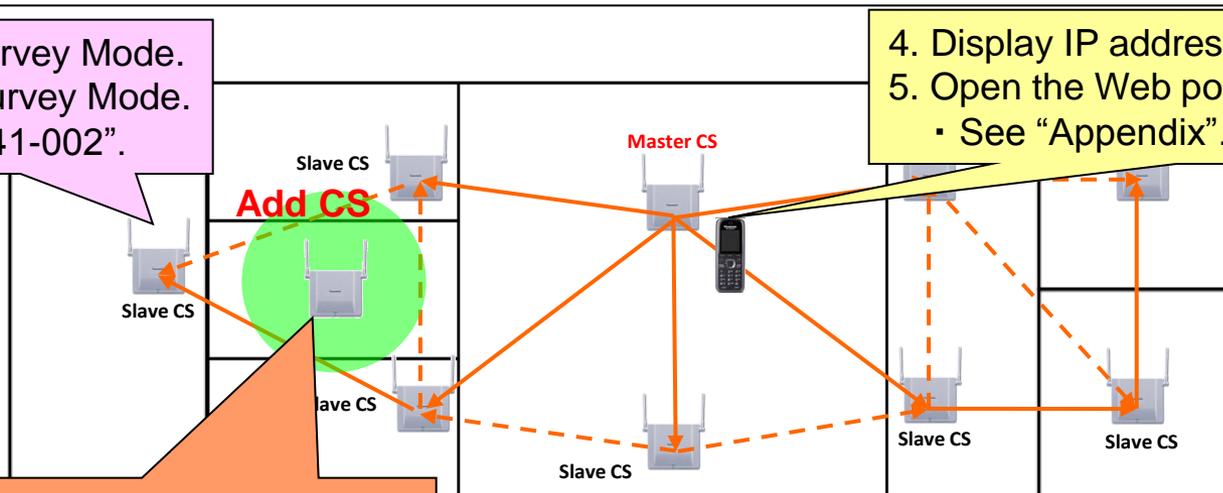


4. Display IP address of Super Master CS.
 5. Open the Web port.
- See "Appendix".


2. Locates it at the green LED position.

Step2 : CS Registration and Tree Survey


Case 1 : Add CS the end of tree by manual, if you already know the configuration of the tree.

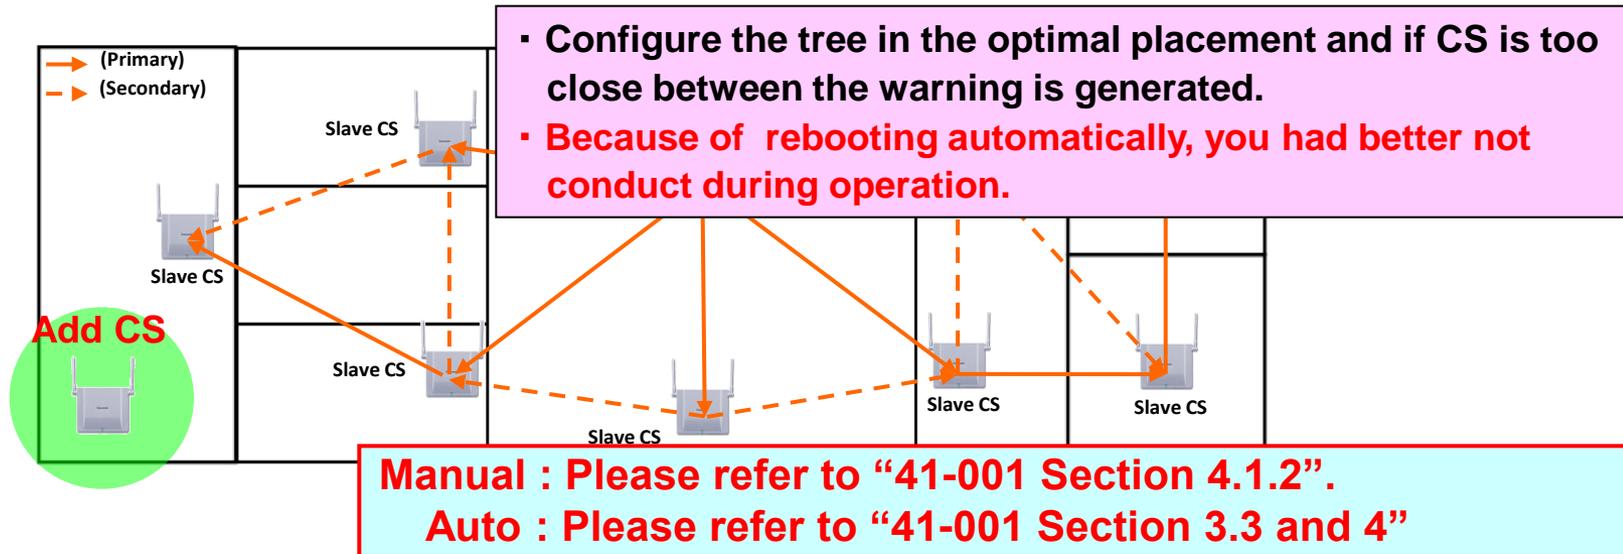

Case 2 : Add CS the inside circle of installed tree.

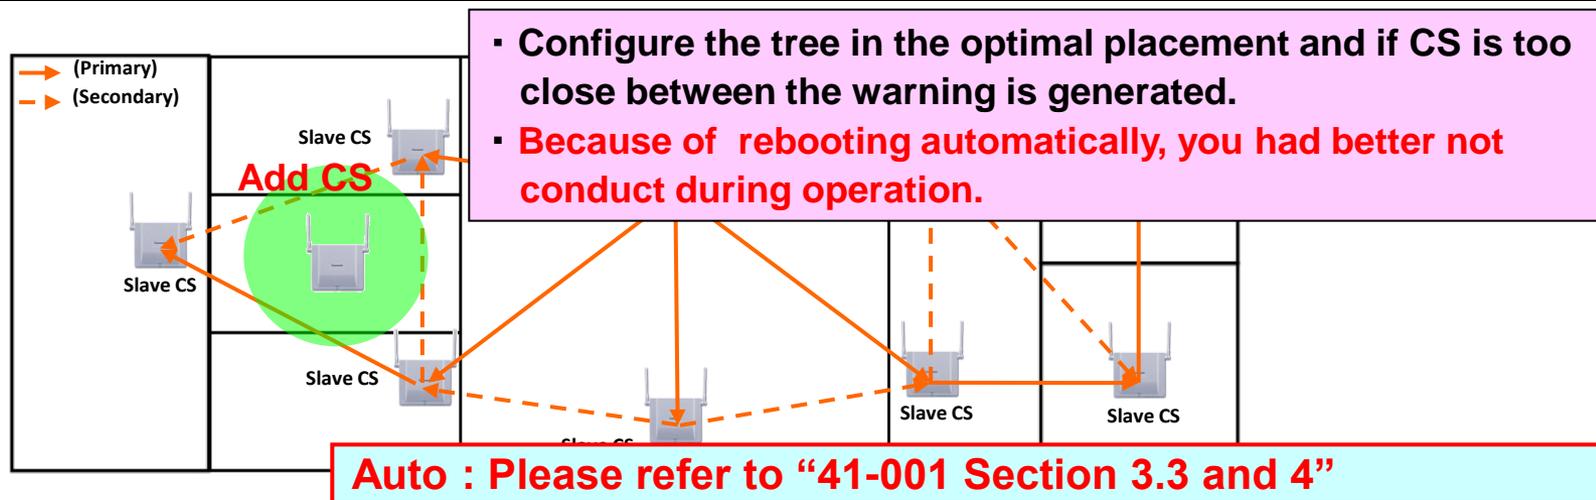


Appendix : How to confirm IP Address of Super Master CS

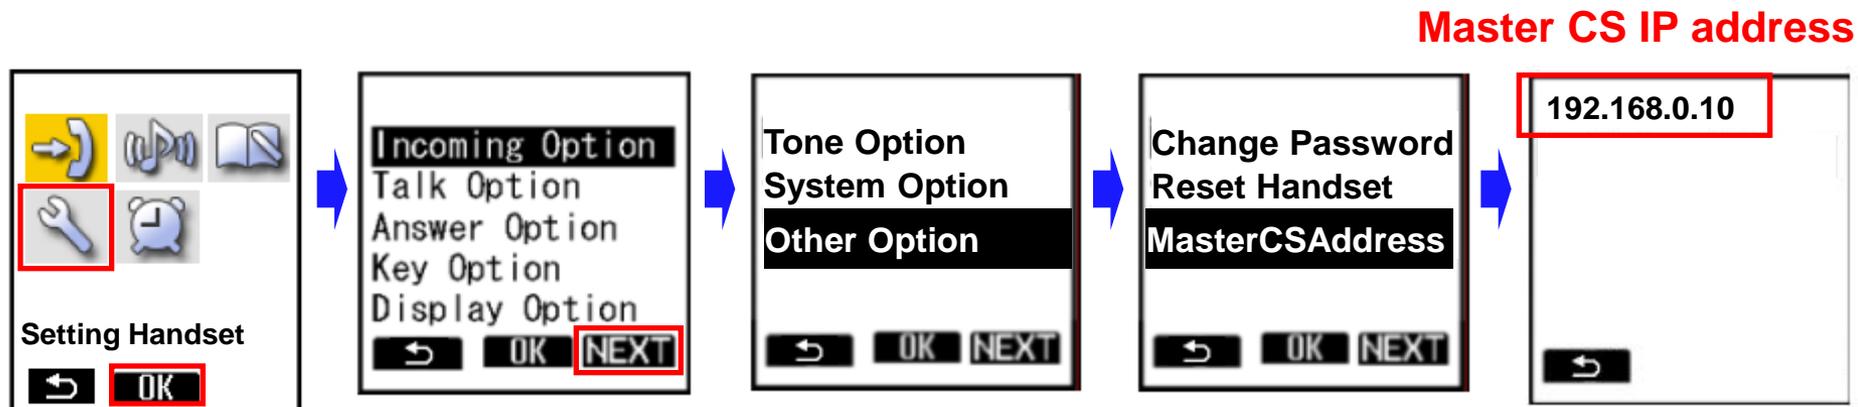

1. Turn on the PS.
2. Press [Menu] or the [CENTER] navigation key.
3. Select **"Setting Handset"** and then press [OK].
4. Press [NEXT].
5. Select **"Other Option"** and then press [OK].
6. Select **"MasterCSAddress"** and the press [OK].
 - Display the Master CS IP address.

Appendix : How to Open the CS Web port

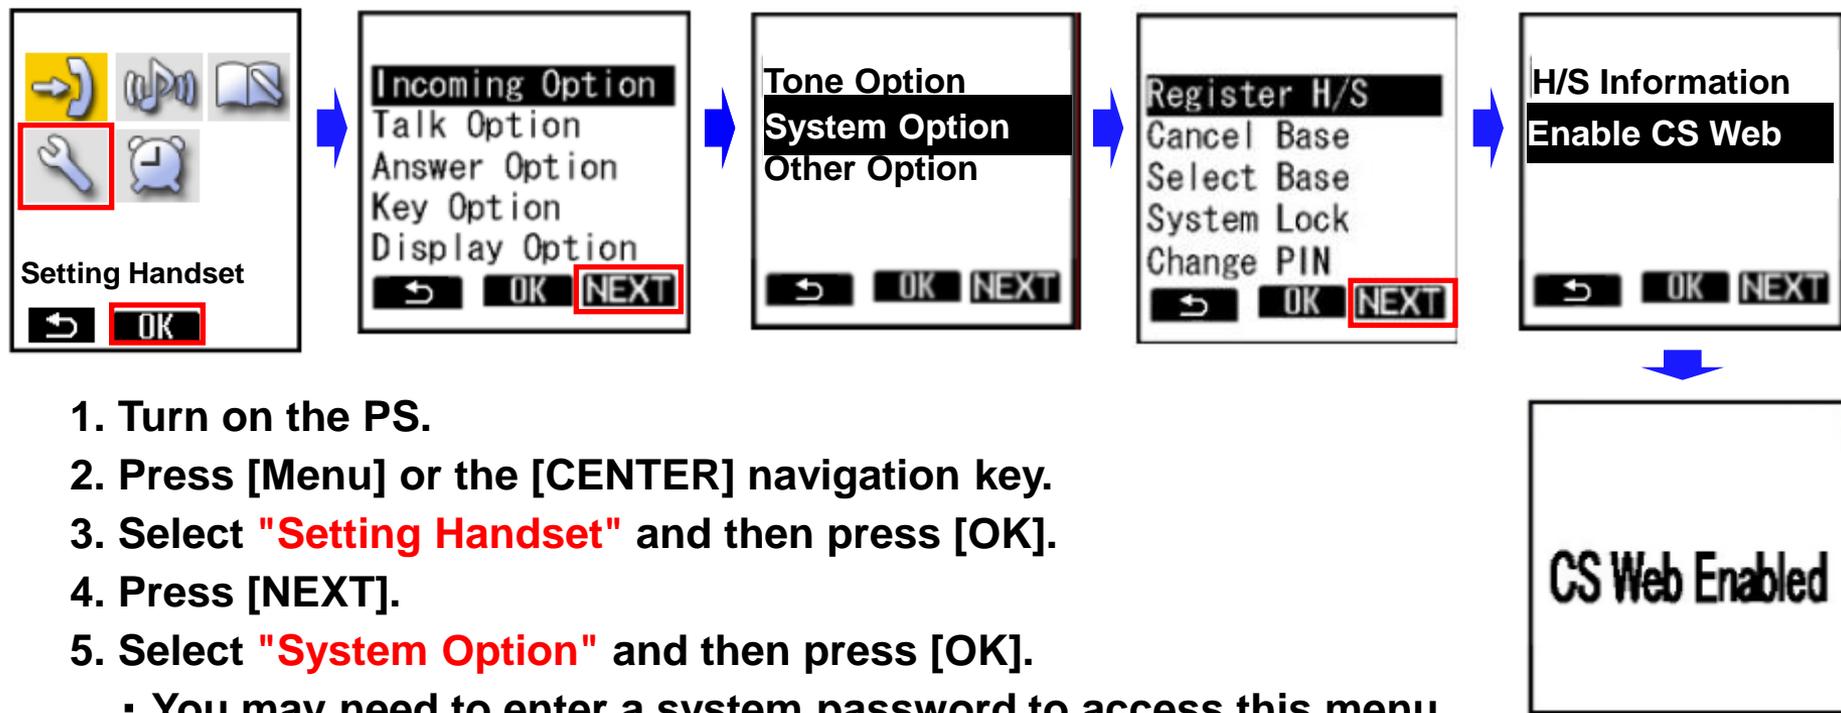

1. Turn on the PS.
2. Press [Menu] or the [CENTER] navigation key.
3. Select **"Setting Handset"** and then press [OK].
4. Press [NEXT].
5. Select **"System Option"** and then press [OK].
 - You may need to enter a system password to access this menu.
6. Press [NEXT] to display the second screen, select **"Enable CS Web"**, and then press [OK].
7. When the operation is complete, "CS Web Enabled" is displayed.